# Variable Area Flowmeters



# G Series and M Series

- Glass and metal (armored) tube models, including miniature armored model
- Highly accurate measurement with individually calibrated scales based on flow tests
- Flexible and adaptable to specific system requirements
- High quality, durability, and repeatability
- 1/8 to 1 1/4 in. process end connections



#### **Contents**

Contents
Variable Area Flowmeters 2
Features 2
Calibration and Testing 2
Cleaning and Packaging 2
Installation 2
Choosing the Right Flowmeter 2
G Series (Glass Tube) Flowmeters 4
G1 Model 5
G2 Model 6
G3 Model 7
G4 Model 8
GM Model 9
GP Model 10
M Series (Metal Tube) Flowmeters
M1 Model 12
M2 Model 13
M3 Model 14
MH Model 16
Dimensions 18
Custom Calibration 20
Options

Accessories . . . . . . . . . . . . 23

#### Variable Area Flowmeters

Swagelok® variable area flowmeters measure the flow rate of liquids and gases by means of a tapered tube and float. The float is pushed up by increasing fluid flow and pulled down by gravity as fluid flow decreases, except for the spring-loaded MH model. Variable area flowmeters do not require external power, but may be ordered with electrical or electronic options.

Most Swagelok models contain integral needle valves at the bottom (inlet) process connection; top mounting is available as an option.

#### **Features**

- Simple installation
- Easy to read
- No wearing parts
- Limit switches available
- 10-to-1 turndown ratio (the lowest measurement is one tenth of the fullscale reading).
- Meters are marked with the fluid media and unit of measure for which they are calibrated.

# **Calibration and Testing**

Every Swagelok variable area flowmeter is factory calibrated to its media, flow range, and accuracy class using clean, dry air for air-flow range models and water for water-flow range models.

- G1, G2, G3, GM, and GP models are calibrated to 17.4 psia (1.2 bar) and 68°F (20°C).
- G4, M1, M2, M3, and MH models are calibrated to 14.7 psia (1.013 bar) and and 68°F (20°C).

Meters can be calibrated to userspecific applications.

# **Cleaning and Packaging**

All Swagelok variable area flowmeters are cleaned to remove dirt, debris, and burrs and are individually boxed. Oiland grease-free cleaning are available on request.

#### Installation

Variable area flowmeters must be oriented vertically, except for the MH model, which is mounted horizontally.

For complete installation information, see the Swagelok *Variable Area Flowmeters Installation Instructions*, *G Series and M Series*, MS-CRD-0111,
available *only* on your Swagelok website.

# **Choosing the Right Flowmeter**



#### Variable Area Flowmeter Selection

Model	Process Temperature Rating °F (°C)	Ambient Temperature Rating °F (°C)	Maximum Inlet Pressure at 70°F (20°C) psig (bar)
G1	23 to 212 (–5 to 100)	-4 to 212 (-20 to 100)	145 (10.0)
G2	23 to 212		145 (10.0)
G3	23 to 212 (–5 to 100)	-4 to 212 (-20 to 100)	145 (10.0)
G4	23 to 212 (–5 to 100)	-4 to 212 (-20 to 100)	145 (10.0)
GM	23 to 212 (–5 to 100)	-4 to 212 (-20 to 100)	58.0 (4.0)
GP	23 to 212 (–5 to 100)	-4 to 212 (-20 to 100)	58.0 (4.0)
M1	-40 to 302 (-40 to 150)	-4 to 158 (-20 to 70)	1885 (130)
M2	-40 to 302 (-40 to 150)	-4 to 158 (-20 to 70)	1885 (130)
M3 (1/2 in. dia tube)	-40 to 572 (-40 to 300)	-40 to 248 (-40 to 120)	2888 (199)
M3 (1 in. dia tube)	-40 to 572 (-40 to 300)	-40 to 248 (-40 to 120)	1393 (96.0)
MH (1/2 in. dia tube)	-40 to 572 (-40 to 300)	-40 to 248 (-40 to 120)	2888 (199)
MH (1 in. dia tube)	-40 to 572 (-40 to 300)	-40 to 248 (-40 to 120)	1393 (96.0)



# **Choosing the Right Flowmeter**

Variable area flowmeters are fitted with measuring tubes made of glass or metal.

- Swagelok G series models contain glass measuring tubes, which allow direct viewing of the process fluid and direct reading of the flow.
- Swagelok M series models contain metal measuring tubes, which are used for difficult operating conditions where pressure, temperature, or both are factors. Because direct readings are not possible with metal tubes, these flowmeters are equipped with mechanical or electronic displays.

See the **Variable Area Flowmeter Selection** table below for a wide selection of flowmeters.

- Standard conditions (std ft³/min and std ft³/h air flow ranges) are defined as 14.7 psia (1.013 bar) at 59°F (15°C) in accordance with ISO 13443.
- Normal conditions (NL/min and NL/h air flow ranges) are defined as 14.7 psia (1.013 bar) at 32°F (0°C) in accordance with DIN 1343.

Fluids with properties different from those of air or water, as well as systems operating at higher pressures or temperatures, may require custom-calibrated flowmeters.

See **Custom Calibration**, page 20, for more information.

#### **Variable Area Flowmeter Selection**

	Air Flow	Ranges			Water Flo	w Ranges		Accuracy	Process End	
NL/min	NL/h	std ft³/min	std ft³/h	L/min	L/h	U.S. gal/min	U.S. gal/h	Class <sup>①</sup>	Connections	Page
0.011 to 0.11 through 2.0 to 20	0.5 to 5.0 through 120 to 1200	0.0004 to 0.004 through 0.07 to 0.7	0.018 to 0.18 through 4.5 to 45	0.004 to 0.04 through 0.27 to 2.7	0.25 to 2.5 through 16 to 160	0.001 to 0.01 through 0.07 to 0.7	0.065 to 0.65 through 4.2 to 42	4.0	1/4 in. NPT	5
0.011 to 0.11 through 8.4 to 84	0.5 to 5.0 through 500 to 5000	0.0004 to 0.004 through 0.3 to 3.0	0.018 to 0.18 through 18 to 180	0.004 to 0.04 through 0.28 to 2.8	0.25 to 2.5 through 16 to 160	0.001 to 0.01 through 0.07 to 0.7	0.065 to 0.65 through 4.2 to 42	2.5	1/4 in. NPT	6
0.027 to 0.27 through 1.3 to 13	1.6 to 16 through 80 to 800	0.001 to 0.01 through 0.05 to 0.5	0.06 to 0.6 through 3.0 to 30	0.008 to 0.08 through 0.17 to 1.7	0.5 to 5.0 through 10 to 100	0.002 to 0.02 through 0.045 to 0.45	0.13 to 1.3 through 2.5 to 25	2.5	1/4 in. NPT	7
0.027 to 0.27 through 5.0 to 50	1.6 to 16 through 300 to 3000	0.001 to 0.01 through 0.18 to 18	0.06 to 0.6 through 11 to 110	0.0007 to 0.007 through 0.17 to 1.7	0.04 to 0.4 through 10 to 100	0.00019 to 0.0019 through 0.045 to 0.45	0.01 to 0.1 through 2.5 to 25	1.0	1/4 in. NPT	8
0.011 to 0.11 through 1.3 to 13	0.5 to 5.0 through 80 to 800	0.0004 to 0.004 through 0.05 to 0.5	0.018 to 0.18 through 3.0 to 30	0.004 to 0.04 through 0.065 to 0.65	0.25 to 2.5 through 4.0 to 40	0.001 to 0.01 through 0.017 to 0.17	0.065 to 0.65 through 1.1 to 11	4.0	G 1/8 (ISO 228)	9
0.011 to 0.11 through 8.4 to 84	0.5 to 5.0 through 500 to 5000	0.0004 to 0.004 through 0.3 to 3.0	0.018 to 0.18 through 18 to 180	0.004 to 0.04 through 0.28 to 2.8	0.25 to 2.5 through 16 to 160	0.001 to 0.01 through 0.07 to 0.7	0.065 to 0.65 through 4.2 to 42	2.5	G 1/4 (ISO 228)	10
0.08 to 0.8 through 6.0 to 60	5.0 to 50 through 340 to 3400	0.003 to 0.03 through 0.2 to 2.0	0.18 to 1.8 through 13 to 130	0.005 to 0.05 through 0.17 to 1.7	0.3 to 3.0 through 10 to 100	0.0013 to 0.013 through 0.045 to 0.45	0.08 to 0.8 through 2.5 to 25	4.0	1/4 in. NPT	12
0.08 to 0.8 through 6.0 to 60	5.0 to 50 through 340 to 3400	0.003 to 0.03 through 0.2 to 2.0	0.18 to 1.8 through 13 to 130	0.005 to 0.05 through 0.17 to 1.7	0.3 to 3.0 through 10 to 100	0.0013 to 0.013 through 0.045 to 0.45	0.08 to 0.8 through 2.5 to 25	2.5	1/4 in. NPT	13
1.1 to 11 through 50 to 500	70 to 700 through 2800 to 28 000	0.04 to 0.4 through 1.6 to 16	2.5 to 25 through 100 to 1000	0.03 to 0.3 through 1.7 to 17	1.8 to 18 through 100 to 1000	0.008 to 0.08 through 0.45 to 4.5	0.48 to 4.8 through 25 to 250	1.6	1/2 and 3/4 in. NPT; 1/2, 3/4, and 1 in. ASME flange	14
25 to 250 through 300 to 3000	1400 to 14 000 through 18 000 to 180 000	1.0 to 10 through 10 to 1000	52 to 520 through 670 to 6700	0.8 to 8.0 through 10 to 100	48 to 480 through 630 to 6300	0.2 to 2.0 through 3.0 to 30	13 to 130 through 160 to 1600	1.6	3/4 and 1 in. NPT; 3/4 and 1 in. ASME flange	14
_	_	_	_	0.11 to 1.1 through 4.0 to 40	7.0 to 70 through 240 to 2400	0.03 to 0.3 through 1.07 to 10.7	2.0 to 20 through 64 to 640	1.6	3/4 in. NPT; 1/2, 3/4, and 1 in. ASME flange	16
_	_	_	_	2.0 to 20 through 17 to 170	130 to 1300 through 1000 to 10 000	0.6 to 6.0 through 4.5 to 45	35 to 350 through 270 to 2700	1.6	1 1/4 in. NPT; 1 in. ASME flange	16

① In accordance with VDI/VDE 3513 Sheet 2: 2008, accuracy class is effectively equivalent to permissible error above  $q_{\rm G}$  = 50 %. where:

Above  $q_{\rm G}$ , the permissible error is constant. Below  $q_{\rm G}$ , the permissible error increases toward lower flow rates inversely proportional. In sizing a flowmeter,  $q_{\rm G}$  = 50 % allows for the greatest accuracy above 50 % of the full scale. For assistance with variable area flowmeter selection, contact your authorized Swagelok sales and service representative.

Fluid media, temperature, pressure, viscosity, and density also must be considered in selecting a variable area flowmeter. See **Custom Calibration**, page 20.



G = Constant permissible error in percent of measured value above  $q_G$ 


 $q_G$  = Flow limit value in percent of full scale

# G Series (Glass Tube) Flowmeters—G1, G2, G3, G4, GM, and GP Models


#### **Features**

- Glass tube design
- Low maintenance
- Optional factory-installed limit switches
- Polycarbonate cover for protection
- Integral needle valve for fine metering, not intended for shutoff

# Reading Glass-Tube Flowmeters

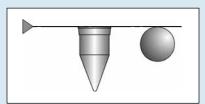

Glass-tube flowmeters are read by the position of the float or ball within the flowmeter tube. The flow rate is read at the top edge of the float or ball.

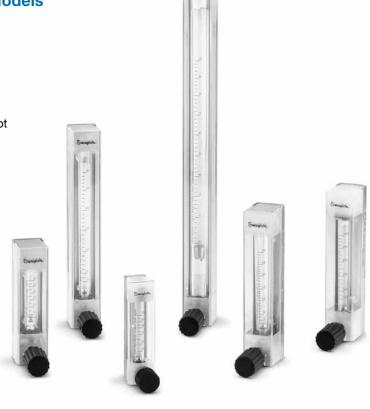

# **Materials of Construction**

# G1, G2, G3, and G4 Models

Component	Material / Specification	
Flowmeter		
Head piece, foot piece	316L stainless steel / EN 1.4404	
Float (G1, G2, G3)	316 stainless steel / EN 1.4401	
Float (G4)	316Ti stainless steel / EN 1.4571	
Measuring tube	Borosilicate glass	
Float stops	PFA with fluorocarbon (FKM) gaskets or PTFE with perfluorocarbon (FFKM) gaskets	
Head piece gasket, foot piece gasket	Fluorocarbon (FKM), perfluorocarbon (FFKM), or EPDM	
Protective cover	Polycarbonate	
Mounting rail	304 stainless steel / EN 1.4301	
	Needle Valve	
Needle	316L stainless steel / EN 1.4404	
Gaskets	PTFE	
0-rings	Fluorocarbon (FKM), perfluorocarbon (FFKM), or EPDM	
Housing, spring	316Ti stainless steel / EN 1.4571	
Spindle	316L stainless steel / EN 1.4404	
Spindle lubricant	PTFE-based	
Knob handle	Plastic	
Knob handle insert	Brass	
Knob handle set screw	A2 stainless steel	

Wetted components listed in italics.



#### **G1 Model**

This G1 model is suitable for low flow rates in fine-metering applications such as gas chromatography.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build a G1 model variable area flowmeter ordering number by combining the designators in the sequence shown below.

4 5 6 7 VAF - G1 - **01M - 1 - 1 - A** 

#### 4 Measured Flow Range Air. NL/min Air. NL/h 01L = 0.011 to 0.1101M = 0.5 to 5.002M = 0.8 to 8.002L = 0.013 to 0.1303M = 1.6 to 1603L = 0.027 to 0.2704L = 0.07 to 0.704M = 4.0 to 4005M = 6.0 to 6005L = 0.1 to 1.006L = 0.17 to 1.706M = 10 to 10007M = 25 to 25007L = 0.42 to 4.208L = 0.83 to 8.308M = 50 to 50009M = 80 to 80009L = 1.3 to 1310L = 2.0 to 2010M = 120 to 1200Air, std ft<sup>3</sup>/min Air, std ft3/h 01R = 0.0004 to 0.00401S = 0.018 to 0.18 02R = 0.0005 to 0.00502S = 0.03 to 0.303S = 0.06 to 0.603R = 0.001 to 0.0104R = 0.002 to 0.0204S = 0.15 to 1.505R = 0.0035 to 0.03505S = 0.22 to 2.206R = 0.006 to 0.0606S = 0.38 to 3.807R = 0.015 to 0.1507S = 0.95 to 9.508R = 0.03 to 0.308S = 1.9 to 1909R = 0.05 to 0.509S = 3.0 to 3010R = 0.07 to 0.710S = 4.5 to 45Water, L/min Water, L/h A1L = 0.004 to 0.04A1M = 0.25 to 2.5A2L = 0.008 to 0.08A2M = 0.50 to 5.0A3L = 0.02 to 0.2A3M = 1.2 to 12A4L = 0.04 to 0.4A4M = 2.5 to 25A5L = 0.065 to 0.65A5M = 4.0 to 40A6L = 0.1 to 1.0A6M = 6.0 to 60A7L = 0.17 to 1.7A7M = 10 to 100A8L = 0.2 to 2.0A8M = 12 to 120A9L = 0.27 to 2.7A9M = 16 to 160Water, U.S. gal/min Water, U.S. gal/h A1R = 0.001 to 0.01A1S = 0.065 to 0.65A2R = 0.002 to 0.02A2S = 0.13 to 1.3A3R = 0.005 to 0.05A3S = 0.30 to 3.0A4R = 0.01 to 0.1A4S = 0.65 to 6.5

# 5 Flowmeter Gasket, Valve O-Ring Material

**1** = Fluorocarbon (FKM) (standard)

2 = Perfluorocarbon (FFKM)

3 = EPDM

6 Limit Switches (See page 20.)

The maximum process and ambient temperatures are reduced to 149°F (65°C) if limit switches are selected. Most G1 model flowmeters can accept up to two limit switches; models with measured water flow ranges A8L, A9L, A8M, A9M, A8R, A9R, A8S, and A9S cannot accept limit switches; also see footnote

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

**0** = None

1 = 0ne switch

2 = Two switches<sup>1</sup>

- 3 = One switch and a one-channel isolated switch amplifier with relay output,
   115 V (ac)
- 4 = Two switches and a two-channel isolated switch amplifier with relay output, 115 V (ac)<sup>⊕</sup>
- 5 = One switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 6 = Two switches and a two-channel isolated switch amplifier with relay output, 230 V (ac)<sup>①</sup>
- ① Not available with measured air flow ranges 10L, 10M, 10R, and 10S, or with measured water flow ranges A7L, A7M, A7R, and A7S.

# 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

 $\mathbf{A} = \text{Limit switch junction box}$ 

**G** = 5-point calibration record

**H** = Pressure test, certificate

**J** = Material certification

**T** = Wall mounting

**W** = Panel mounting

**X** = 0il- and grease-free cleaning (**required** for oxygen service)

Y = No needle valve

**Z** = Top-mounted needle valve

# Successor

# Dimensions

See page 18 for G1 model dimensions.

#### **Custom**

See Custom Calibration, page 20.

A5R = 0.017 to 0.17

A6R = 0.025 to 0.25

A7R = 0.045 to 0.45

A8R = 0.055 to 0.55

A9R = 0.07 to 0.7

 $\mathbf{GAS} = \mathbf{Gas} \qquad \qquad \mathbf{LIQ} = \mathbf{Liquid}$ 

A5S = 1.1 to 11

A6S = 1.6 to 16

A7S = 2.5 to 25

A8S = 3.0 to 30

A9S = 4.2 to 42

## **G2 Model**

Commonly used in analytical instrumentation applications, the G2 model is appropriate for low to medium flow rates.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build a G2 model variable area flowmeter ordering number by combining the designators in the sequence shown below.



#### 4 Measured Flow Range

ivieasureu riuw nari	y <del>c</del>
Air, NL/min	Air, NL/h
<b>01L</b> = $0.011$ to $0.11$	01M = 0.5  to  5.0
02L = 0.013  to  0.13	02M = 0.8  to  8.0
03L = 0.027  to  0.27	03M = 1.6  to  16
04L = 0.07  to  0.7	04M = 4.0  to  40
<b>05L</b> = $0.1$ to $1.0$	05M = 6.0  to  60
06L = 0.17  to  1.7	06M = 10  to  100
<b>07L</b> = $0.42$ to $4.2$	07M = 25  to  250
08L = 0.83  to  8.3	08M = 50  to  500
<b>09L</b> = 1.3 to 13	09M = 80  to  800
<b>10L</b> = 1.7 to 17	10M = 100  to  1000
<b>11L</b> = 3.0 to 30	11M = 180  to  1800
12L = 4.0  to  40	12M = 240  to  2400
13L = 5.0  to  50	13M = 300  to  3000
<b>14L</b> = 6.8 to 68	14M = 400  to  4000
<b>15L</b> = 8.4 to 84	<b>15M</b> = 500 to 5000
Air, std ft³/min	Air, std ft³/h
<b>Air, std ft³/min 01R</b> = 0.0004 to 0.004	<b>Air, std ft³/h 01S</b> = 0.018 to 0.18
,	•
01R = 0.0004  to  0.004	<b>01S</b> = $0.018$ to $0.18$
<b>01R</b> = 0.0004 to 0.004 <b>02R</b> = 0.0005 to 0.005	<b>01S</b> = 0.018 to 0.18 <b>02S</b> = 0.03 to 0.3
<b>01R</b> = 0.0004 to 0.004 <b>02R</b> = 0.0005 to 0.005 <b>03R</b> = 0.001 to 0.01	<b>01S</b> = 0.018 to 0.18 <b>02S</b> = 0.03 to 0.3 <b>03S</b> = 0.06 to 0.6
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02	<b>01S</b> = 0.018 to 0.18 <b>02S</b> = 0.03 to 0.3 <b>03S</b> = 0.06 to 0.6 <b>04S</b> = 0.15 to 1.5
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3 09R = 0.05 to 0.5 10R = 0.06 to 0.6 11R = 0.1 to 1.0	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19 09S = 3.0 to 30 10S = 4.5 to 45 11S = 6.5 to 65
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3 09R = 0.05 to 0.5 10R = 0.06 to 0.6 11R = 0.1 to 1.0 12R = 0.14 to 1.4	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19 09S = 3.0 to 30 10S = 4.5 to 45
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3 09R = 0.05 to 0.5 10R = 0.06 to 0.6 11R = 0.1 to 1.0 12R = 0.14 to 1.4 13R = 0.18 to 1.8	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19 09S = 3.0 to 30 10S = 4.5 to 45 11S = 6.5 to 65 12S = 9.0 to 90 13S = 11 to 110
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3 09R = 0.05 to 0.5 10R = 0.06 to 0.6 11R = 0.1 to 1.0 12R = 0.14 to 1.4 13R = 0.18 to 1.8 14R = 0.24 to 2.4	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19 09S = 3.0 to 30 10S = 4.5 to 45 11S = 6.5 to 65 12S = 9.0 to 90 13S = 11 to 110 14S = 14 to 140
01R = 0.0004 to 0.004 02R = 0.0005 to 0.005 03R = 0.001 to 0.01 04R = 0.002 to 0.02 05R = 0.0035 to 0.035 06R = 0.006 to 0.06 07R = 0.015 to 0.15 08R = 0.03 to 0.3 09R = 0.05 to 0.5 10R = 0.06 to 0.6 11R = 0.1 to 1.0 12R = 0.14 to 1.4 13R = 0.18 to 1.8	01S = 0.018 to 0.18 02S = 0.03 to 0.3 03S = 0.06 to 0.6 04S = 0.15 to 1.5 05S = 0.22 to 2.2 06S = 0.38 to 3.8 07S = 0.95 to 9.5 08S = 1.9 to 19 09S = 3.0 to 30 10S = 4.5 to 45 11S = 6.5 to 65 12S = 9.0 to 90 13S = 11 to 110

#### Custom

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid

Water, L/min	Water, L/h
A1L = 0.004  to  0.04	•
A2L = 0.008  to  0.08	A2M = 0.50  to  5.0
A3L = 0.02  to  0.2	A3M = 1.2  to  12
A4L = 0.04  to  0.4	A4M = 2.5  to  25
<b>A5L</b> = $0.065$ to $0.65$	A5M = 4.0  to  40
<b>A6L</b> = $0.1$ to $1.0$	A6M = 6.0  to  60
A7L = 0.17  to  1.7	A7M = 10  to  100
<b>A8L</b> = $0.2$ to $2.0$	A8M = 12  to  120
<b>A9L</b> = $0.28$ to $2.8$	A9M = 16  to  160
Water, U.S. gal/min	Water, U.S. gal/h
<b>Water, U.S. gal/min A1R</b> = 0.001 to 0.01	<b>Water, U.S. gal/h A1S</b> = 0.065 to 0.65
, •	
A1R = 0.001  to  0.01	<b>A1S</b> = $0.065$ to $0.65$ <b>A2S</b> = $0.13$ to $1.3$
<b>A1R</b> = 0.001 to 0.01 <b>A2R</b> = 0.002 to 0.02	<b>A1S</b> = $0.065$ to $0.65$ <b>A2S</b> = $0.13$ to $1.3$
<b>A1R</b> = 0.001 to 0.01 <b>A2R</b> = 0.002 to 0.02 <b>A3R</b> = 0.005 to 0.05	<b>A1S</b> = 0.065 to 0.65 <b>A2S</b> = 0.13 to 1.3 <b>A3S</b> = 0.30 to 3.0
A1R = 0.001 to 0.01 A2R = 0.002 to 0.02 A3R = 0.005 to 0.05 A4R = 0.01 to 0.1	<b>A1S</b> = 0.065 to 0.65 <b>A2S</b> = 0.13 to 1.3 <b>A3S</b> = 0.30 to 3.0 <b>A4S</b> = 0.65 to 6.5
A1R = 0.001 to 0.01 A2R = 0.002 to 0.02 A3R = 0.005 to 0.05 A4R = 0.01 to 0.1 A5R = 0.017 to 0.17	<b>A1S</b> = 0.065 to 0.65 <b>A2S</b> = 0.13 to 1.3 <b>A3S</b> = 0.30 to 3.0 <b>A4S</b> = 0.65 to 6.5 <b>A5S</b> = 1.1 to 11
A1R = 0.001 to 0.01 A2R = 0.002 to 0.02 A3R = 0.005 to 0.05 A4R = 0.01 to 0.1 A5R = 0.017 to 0.17 A6R = 0.025 to 0.25	A1S = 0.065 to 0.65 A2S = 0.13 to 1.3 A3S = 0.30 to 3.0 A4S = 0.65 to 6.5 A5S = 1.1 to 11 A6S = 1.6 to 16

#### 5 Flowmeter Gasket, Valve O-Ring Material

**1** = Fluorocarbon (FKM) (standard)

2 = Perfluorocarbon (FFKM)

3 = EPDM

#### **Dimensions**

See page 18 for G2 model dimensions.



# 6 Limit Switches (See page 20.)

The maximum process and ambient temperatures are reduced to 149°F (65°C) if limit switches are selected.

Most G2 model flowmeters can accept up to two limit switches; see footnote below.

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- $\mathbf{0} = None$
- 1 = 0ne switch
- 2 = Two switches<sup>1</sup>
- 3 = One switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 4 = Two switches and a two-channel isolated switch amplifier with relay output, 115 V (ac)<sup>©</sup>
- 5 = One switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 6 = Two switches and a two-channel isolated switch amplifier with relay output, 230 V (ac)<sup>⊕</sup>
- ① Not available with measured air flow ranges 13L, 14L, 15L, 13S, 14S, 15S, 13M, 14M, 15M, 13R, 14R, and 15R, or with measured water flow ranges A7L, A8L, A9L, A7M, A8M, A9M, A7R, A8R, A9R, A7S, A8S, and A9S.

# 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{A} = \text{Limit switch junction box}$
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- T = Wall mounting
- W = Panel mounting
- **X** = 0il- and grease-free cleaning (**required** for oxygen service)
- Y = No needle valve
- $\mathbf{Z} =$ Top-mounted needle valve



#### **G3 Model**

The G3 model provides reliable, accurate measurement over the mid ranges of air or water flow.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build a G3 model variable area flowmeter ordering number by combining the designators in the sequence shown below.

4 5 6 7 VAF - G3 - **01M - 1 - 1 - A** 

# 4 Measured Flow Range

Measured Flow Rang	ge
Air, NL/min	Air, NL/h
<b>01L</b> = $0.027$ to $0.27$	01M = 1.6  to  16
02L = 0.07  to  0.7	02M = 4.0  to  40
03L = 0.1  to  1.0	03M = 6.0  to  60
04L = 0.17  to  1.7	04M = 10  to  100
<b>05L</b> = $0.42$ to $4.2$	05M = 25  to  250
<b>06L</b> = $0.83$ to $8.3$	06M = 50  to  500
<b>07L</b> = 1.3 to 13	07M = 80  to  800
Air, std ft³/min	Air, std ft³/h
01R = 0.001  to  0.01	<b>01S</b> = $0.06$ to $0.6$
02R = 0.002  to  0.02	<b>02S</b> = 0.15 to 1.5
03R = 0.0035 to $0.035$	<b>03S</b> = 0.21 to 2.1
04R = 0.006  to  0.06	<b>04S</b> = 0.38 to 3.8
05R = 0.015  to  0.15	<b>05S</b> = 0.95 to 9.5
06R = 0.03  to  0.3	<b>06S</b> = 1.9 to 19
07R = 0.05  to  0.5	<b>07S</b> = 3.0 to 30
Water, L/min	Water, L/h
A1L = 0.008  to  0.08	A1M = 0.5  to  5.0
A2L = 0.02  to  0.2	A2M = 1.2  to  12
A3L = 0.04  to  0.4	A3M = 2.5  to  25
A4L = 0.065  to  0.65	A4M = 4.0  to  40
<b>A5L</b> = $0.1$ to $1.0$	A5M = 6.0  to  60
<b>A6L</b> = $0.17$ to $1.7$	A6M = 10  to  100
Water, U.S. gal/min	Water, U.S. gal/h
A1R = 0.002  to  0.02	<b>A1S</b> = $0.13$ to $1.3$
A2R = 0.005  to  0.05	A2S = 0.25  to  2.5
A3R = 0.01  to  0.1	A3S = 0.65  to  6.5
A4R = 0.017  to  0.17	<b>A4S</b> = 1.1 to 11
A5R = 0.025  to  0.25	<b>A5S</b> = $1.6$ to $16$
A6R = 0.045  to  0.45	<b>A6S</b> = $2.5 \text{ to } 25$

#### Custom

See Custom Calibration, page 20.

 $\mathbf{GAS} = \mathbf{Gas} \qquad \qquad \mathbf{LIQ} = \mathbf{Liquid}$ 

# 5 Flowmeter Gasket, Valve O-Ring Material

- **1** = Fluorocarbon (FKM) (standard)
- 2 = Perfluorocarbon (FFKM)
- 3 = EPDM

# 6 Limit Switches (See page 20.)

The maximum process and ambient temperatures are reduced to 149°F (65°C) if limit switches are selected. Most G3 model flowmeters can accept up to two limit switches; see footnote below.

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- $\mathbf{0} = None$
- 1 = 0ne switch
- 2 = Two switches<sup>1</sup>
- 3 = One switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 4 = Two switches and a two-channel isolated switch amplifier with relay output, 115 V (ac)<sup>①</sup>
- 5 = One switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 6 = Two switches and a two-channel isolated switch amplifier with relay output, 230 V (ac)<sup>①</sup>
- ① Not available with measured flow ranges A6L, A6M, A6R, and A6S.

# 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{A} = \text{Limit switch junction box}$
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- T = Wall mounting
- **W** = Panel mounting
- **X** = Oil- and grease-free cleaning (**required** for oxygen service)
- Y = No needle valve
- **Z** = Top-mounted needle valve



#### **Dimensions**

See page 18 for G3 model dimensions.



# **G4 Model**

Suitable for laboratory applications, the large-size G4 model is highly accurate over its full measured flow range.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

Air, NL/h

# **Ordering Information**

Build a G4 model variable area flowmeter ordering number by combining the designators in the sequence shown below.



# 4 Measured Flow Range

Air, NL/min

AII, IVL/IIIIII	AII, IVL/II
01L = 0.027  to  0.27	01M = 1.6  to  16
02L = 0.042  to  0.42	02M = 2.5  to  25
03L = 0.07  to  0.7	03M = 4.0  to  40
04L = 0.1  to  1.0	04M = 6.0  to  60
<b>05L</b> = $0.15$ to $1.5$	05M = 9.0  to  90
<b>06L</b> = $0.23$ to $2.3$	06M = 14  to  140
<b>07L</b> = $0.33$ to $3.3$	07M = 20  to  200
08L = 0.5  to  5.0	08M = 30  to  300
09L = 0.83  to  8.3	09M = 50  to  500
<b>10L</b> = 1.33 to 13.3	10M = 80  to  800
<b>11L</b> = 2.0 to 20	11M = 120  to  1200
<b>12L</b> = 3.33 to 33.3	12M = 200  to  2000
13L = 5.0  to  50	13M = 300  to  3000
Air, std ft³/min	Air, std ft³/h
01R = 0.001  to  0.01	<b>01S</b> = $0.06$ to $0.6$
02R = 0.0015  to  0.015	02S = 0.095  to  0.95
03R = 0.0023  to  0.023	<b>03S</b> = 0.15 to 1.5
04R = 0.0035  to  0.035	<b>04S</b> = 0.22 to 2.2
<b>05R</b> = $0.0051$ to $0.051$	<b>05S</b> = $0.35$ to $3.5$
06R = 0.0082  to  0.082	<b>06S</b> = $0.50$ to $5.0$
07R = 0.012  to  0.12	<b>07S</b> = 0.75 to 7.5
08R = 0.018  to  0.18	<b>08S</b> = 1.1 to 11
09R = 0.03  to  0.3	<b>09S</b> = 1.9 to 19
10R = 0.05  to  0.5	<b>10S</b> = 3.0 to 30
11R = 0.072  to  0.72	<b>11S</b> = 4.5 to 45
12R = 0.12  to  1.2	<b>12S</b> = 7.5 to 75
13R = 0.18  to  1.8	<b>13S</b> = 11 to 110
Water, L/min	Water, L/h
<b>A1L</b> = $0.0007$ to $0.007$	A1M = 0.04  to  0.4
A2L = 0.001  to  0.01	A2M = 0.063  to  0.63
A3L = 0.0018  to  0.018	A3M = 0.1  to  1.0
A4L = 0.0025  to  0.025	<b>A4M</b> = $0.16$ to $1.6$
<b>A5L</b> = $0.004$ to $0.04$	A5M = 0.25  to  2.5
A6L = 0.007  to  0.07	<b>A6M</b> = $0.4 \text{ to } 4.0$
A7L = 0.01  to  0.1	A7M = 0.6  to  6.0
<b>A8L</b> = $0.017$ to $0.17$	<b>A8M</b> = $1.0 \text{ to } 10$
A9L = 0.025  to  0.25	A9M = 1.6  to  16
<b>B1L</b> = $0.04$ to $0.4$	<b>B1M</b> = $2.5 \text{ to } 25$
<b>B2L</b> = $0.065$ to $0.65$	<b>B2M</b> = $4.0 \text{ to } 40$
<b>B3L</b> = $0.1 \text{ to } 1.0$	B3M = 6.3  to  63
<b>B4L</b> = $0.17$ to $1.7$	<b>B4M</b> = $10 \text{ to } 100$

Water, U.S. gal/min	Water, U.S. gal/h
A1R = 0.00019  to  0.0019	<b>A1S</b> = $0.01$ to $0.1$
A2R = 0.0003  to  0.003	<b>A2S</b> = $0.016$ to $0.16$
A3R = 0.00045  to  0.0045	A3S = 0.025  to  0.25
A4R = 0.0007  to  0.007	A4S = 0.04  to  0.4
A5R = 0.001  to  0.01	<b>A5S</b> = $0.065$ to $0.65$
A6R = 0.0019  to  0.019	<b>A6S</b> = $0.1 \text{ to } 1.0$
A7R = 0.0025  to  0.025	A7S = 0.16  to  1.6
<b>A8R</b> = $0.0045$ to $0.045$	<b>A8S</b> = $0.25$ to $2.5$
A9R = 0.007  to  0.07	<b>A9S</b> = $0.4 \text{ to } 4.0$
<b>B1R</b> = $0.01$ to $0.1$	<b>B1S</b> = $0.65$ to $6.5$
<b>B2R</b> = $0.017$ to $0.17$	<b>B2S</b> = $1.0 \text{ to } 10$
<b>B3R</b> = $0.03$ to $0.3$	<b>B3S</b> = $1.6 \text{ to } 16$
<b>B4R</b> = $0.045$ to $0.45$	<b>B4S</b> = $2.5 \text{ to } 25$

#### 5 Flowmeter Gasket, Valve O-Ring Material

1 = Fluorocarbon (FKM) (standard)

2 = Perfluorocarbon (FFKM)

3 = EPDM

#### **Dimensions**

See page 18 for G4 model dimensions.



# 6 Limit Switches (See page 20.)

The maximum process and ambient temperatures are reduced to 149°F (65°C) if limit switches are selected.

Most G4 model flowmeters can accept up to two limit switches; models with measured air flow ranges O1L, O2L, O3L, 11L, 12L, 13L, O1M, O2M, O3M, 11M, 12M, 13M, O1R, O2R, O3R, 11R, 12R, 13R, O1S, O2S, O3S, 11S, 12S, and 13S, or with measured water flow ranges A1L, A2L, A3L, B2L, B3L, B4L, A1M, A2M, A3M, B2M, B3M, B4M, A1R, A2R, A3R, B2R, B3R, B4R, A1S, A2S, A3S, B2S, B3S, and B4S cannot accept limit switches.

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- $\mathbf{0} = None$
- 1 = 0ne switch
- 2 = Two switches
- 3 = One switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 4 = Two switches and a two-channel isolated switch amplifier with relay output, 115 V (ac)
- 5 = One switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 6 = Two switches and a two-channel isolated switch amplifier with relay output, 230 V (ac)

#### 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{A} = \text{Limit switch junction box}$
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- **W** = Panel mounting
- **X** = 0il- and grease-free cleaning (**required** for oxygen service)
- Y = No needle valve
- **Z** = Top-mounted needle valve

#### Custom

See Custom Calibration, page 20.

**GAS** = Gas **LIQ** = Liquid



#### **GM Model**

This miniature glass-tube model has a plastic head and foot piece and can be panel mounted easily.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.


#### **Materials of Construction**

Component	Material / Specification	
Flowmeter		
Head piece, foot piece	PVDF	
Float	316 stainless steel / EN 1.4401	
Measuring tube	Borosilicate glass	
Float stops	PFA with fluorocarbon (FKM) gaskets or PTFE with perfluorocarbon (FFKM) gaskets	
Head piece gasket, foot piece gasket	Fluorocarbon (FKM)	
Protective cover	Polycarbonate	
Mounting rail	Aluminum 6060	
Need	lle Valve	
Needle	316L stainless steel / EN 1.4404	
Gaskets	PTFE	
0-rings	Fluorocarbon (FKM)	
Housing, spring	316Ti stainless steel / EN 1.4571	
Spindle	316L stainless steel / EN 1.4404	
Spindle lubricant	PTFE-based	
Knob handle	Aluminum 6060	
Knob handle insert	Brass	
Knob handle set screw	A2 stainless steel	

Wetted components listed in italics.

# **Ordering Information**

Build a GM model variable area flowmeter ordering number by combining the designators in the sequence shown below.

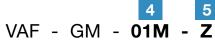

	• • • • • • • • • • • • • • • • • • • •	•
4 Measured Flow Rang	e	
Air, NL/min	Air, NL/h	
<b>01L</b> = 0.011 to 0.11	01M = 0.5  to	5.0
02L = 0.013  to  0.13	02M = 0.8  to	8.0
03L = 0.027  to  0.27	03M = 1.6  to	16
<b>04L</b> = $0.07$ to $0.7$	04M = 4.0  to	40
05L = 0.1  to  1.0	05M = 6.0  to	60
<b>06L</b> = $0.17$ to $1.7$	06M = 10  to	100
<b>07L</b> = 0.42 to 4.2	07M = 25  to	250
08L = 0.83  to  8.3	08M = 50  to	500
<b>09L</b> = 1.3 to 13	09M = 80  to	800
Air, std ft³/min	Air, std ft <sup>3</sup> /h	
01R = 0.0004  to  0.004	01S = 0.018	to 0.18
02R = 0.0005  to  0.005	02S = 0.03  t	o 0.3
03R = 0.001  to  0.01	03S = 0.06  t	o 0.6
04R = 0.002  to  0.02	<b>04S</b> = 0.15 t	o 1.5
05R = 0.0035  to  0.035	05S = 0.22  t	0 2.2
06R = 0.006  to  0.06	06S = 0.38  t	0 3.8
07R = 0.015  to  0.15	07S = 0.95  t	
08R = 0.03  to  0.3	08S = 1.9  to	
09R = 0.05  to  0.5	09S = 3.0  to	30
Water, L/min	Water, L/h	
A1L = 0.004  to  0.04	A1M = 0.25 t	0 2.5
A2L = 0.008  to  0.08	A2M = 0.50  t	o 5.0
A3L = 0.02  to  0.2	A3M = 1.2  to	12
A4L = 0.04  to  0.4	A4M = 2.5  to	
<b>A5L</b> = $0.065$ to $0.65$	<b>A5M</b> = $4.0 \text{ to}$	40
Water, U.S. gal/min	Water, U.S. g	al/h

#### **Custom**

A1R = 0.001 to 0.01

A2R = 0.002 to 0.02

A3R = 0.005 to 0.05

A5R = 0.017 to 0.17

A4R = 0.01 to 0.1

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid

A1S = 0.065 to 0.65

A2S = 0.13 to 1.3

A3S = 0.30 to 3.0

A4S = 0.65 to 6.5

A5S = 1.1 to 11

**Options** (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

W = Panel mounting

 $\mathbf{Z} = \text{Top-mounted needle valve}$ 



#### **Dimensions**

See page 18 for GM model dimensions.



# **GP Model**

The GP model offers a plastic head and foot piece, including end connections.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Materials of Construction**

Component	Material / Specification	
Flowmeter		
Head piece, foot piece	PVDF	
Float	316 stainless steel / EN 1.4401	
Measuring tube	Borosilicate glass	
Float stops	PFA with fluorocarbon (FKM) gaskets, PTFE with perfluorocarbon (FFKM) gaskets, or EPDM	
Head piece gasket, foot piece gasket	Fluorocarbon (FKM) or Perfluorocarbon (FFKM)	
Protective cover	Polycarbonate	
Mounting rail	304 stainless steel / EN 1.4301	
Need	lle Valve	
Needle	316L stainless steel / EN 1.4404	
Gaskets	PTFE	
0-rings	Fluorocarbon (FKM), perfluorocarbon (FFKM), or EPDM	
Housing, spring	316Ti stainless steel / EN 1.4571	
0	316L stainless steel /	
Spindle	EN 1.4404	
Spindle Spindle lubricant	EN 1.4404 PTFE-based	
,		
Spindle lubricant	PTFE-based	

Wetted components listed in italics.

# **Ordering Information**

14R = 0.24 to 2.4

15R = 0.3 to 3.0

Build a GP model variable area flowmeter ordering number by combining the designators in the sequence shown below.

4 Measured Flow Ran	ae		
Air, NL/min	Air, NL/h	Water, L/min	Water, L
<b>01L</b> = 0.011 to 0.11	01M = 0.5  to  5.0	<b>A1L</b> = $0.004$ to $0.04$	$\mathbf{A1M} = 0$
<b>02L</b> = 0.013 to 0.13	02M = 0.8  to  8.0	A2L = 0.008  to  0.08	A2M = 0
<b>03L</b> = 0.027 to 0.27	03M = 1.6  to  16	A3L = 0.02  to  0.2	A3M = 1
<b>04L</b> = 0.07 to 0.7	04M = 4.0  to  40	A4L = 0.04  to  0.4	A4M = 2
<b>05L</b> = 0.1 to 1.0	05M = 6.0  to  60	A5L = 0.065  to  0.65	A5M = 4
06L = 0.17  to  1.7	06M = 10  to  100	<b>A6L</b> = $0.1 \text{ to } 1.0$	A6M = 6
<b>07L</b> = 0.42 to 4.2	07M = 25  to  250	A7L = 0.17  to  1.7	A7M = 1
08L = 0.83  to  8.3	08M = 50  to  500	<b>A8L</b> = $0.2$ to $2.0$	A8M = 1
<b>09L</b> = 1.3 to 13	09M = 80  to  800	<b>A9L</b> = $0.28$ to $2.8$	A9M = 1
<b>10L</b> = 1.7 to 17	10M = 100  to  1000	Water, U.S. gal/min	Water, U.
<b>11L</b> = $3.0 \text{ to } 30$	11M = 180  to  1800	A1R = 0.001  to  0.01	<b>A1S</b> $= 0$
12L = 4.0  to  40	12M = 240  to  2400	A2R = 0.002  to  0.02	A2S = 0
<b>13L</b> = 5 to 50	13M = 300  to  3000	A3R = 0.005  to  0.05	A3S = 0
14L = 6.8  to  68	14M = 400  to  4000	A4R = 0.01  to  0.1	A4S = 0
<b>15L</b> = 8.4 to 84	15M = 500  to  5000	A5R = 0.017  to  0.17	<b>A5S</b> = 1
Air, std ft³/min	Air, std ft³/h	A6R = 0.025  to  0.25	<b>A6S</b> = 1
01R = 0.0004  to  0.004	<b>01S</b> = $0.018$ to $0.18$	A7R = 0.045  to  0.45	A7S = 2
02R = 0.0005  to  0.005	02S = 0.03  to  0.3	A8R = 0.054  to  0.54	<b>A8S</b> = 3
03R = 0.001  to  0.01	03S = 0.06  to  0.6	A9R = 0.07  to  0.7	<b>A9S</b> = $4$
04R = 0.002  to  0.02	<b>04S</b> = 0.15 to 1.5		
05R = 0.0035  to  0.035	<b>05S</b> = 0.22 to 2.2	Custom	
06R = 0.006  to  0.06	06S = 0.38  to  3.8	See <b>Custom Calibratio</b>	<b>n,</b> page 20.
07R = 0.015  to  0.15	07S = 0.95  to  9.5	GAS = Gas	LIQ = Lic
08R = 0.03  to  0.3	<b>08S</b> = 1.9 to 19		
09R = 0.05  to  0.5	<b>09S</b> = 3.0 to 30		
10R = 0.06  to  0.6	<b>10S</b> = 4.5 to 45		
11R = 0.1  to  1.0	11S = 6.5  to  65	<b>Dimensions</b>	
12R = 0.14  to  1.4	12S = 9.0  to  90	See page 18	Sweglick
13R = 0.18  to  1.8	<b>13S</b> = 11 to 110	for CD model	Swagedo

14S = 14 to 140

**15S** = 18 to 180

for GP model dimensions.



 $\mathbf{LIQ} = \mathbf{Liquid}$ 

Water, L/h A1M = 0.25 to 2.5A2M = 0.50 to 5.0A3M = 1.2 to 12A4M = 2.5 to 25A5M = 4.0 to 40A6M = 6.0 to 60A7M = 10 to 100A8M = 12 to 120A9M = 16 to 160Water, U.S. gal/h A1S = 0.065 to 0.65**A2S** = 0.13 to 1.3A3S = 0.30 to 3.0A4S = 0.65 to 6.5A5S = 1.1 to 11A6S = 1.6 to 16A7S = 2.5 to 25**A8S** = 3.0 to 30A9S = 4.2 to 42



# M Series (Metal Tube) Flowmeters— M1, M2, M3, and MH Models

#### **Features**

- Armored design for extreme operating conditions
- Measurement in multiple flow directions
- Ideal for industrial sector applications
- Metal measuring tube for increased durability
- Horizontal mounting (MH model) available



# 5 Flowmeter Gasket, Valve O-Ring Material

- **1** = Fluorocarbon (FKM) (standard)
- 2 = Perfluorocarbon (FFKM)
- 3 = EPDM

# 6 Limit Switches (See page 20.)

The maximum process and ambient temperatures are reduced to 149°F (65°C) if limit switches are selected.

Most GP model flowmeters can accept up to two limit switches; see footnote below.

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- **0** = None
- 1 = 0ne switch
- 2 = Two switches®
- 3 = One switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 4 = Two switches and a two-channel isolated switch amplifier with relay output, 115 V (ac)<sup>①</sup>
- 5 = One switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 6 = Two switches and a two-channel isolated switch amplifier with relay output, 230 V (ac)<sup>①</sup>
- ① Not available with measured air flow ranges 13L, 14L, 15L, 13M, 14M, 15M, 13R, 14R, 15R, 13S, 14S, and 15S or with measured° water flow ranges A7L, A8L, A9L, A7M, A8M, A9M, A7R, A8R, A9R, A7S, A8S, and A9S.

# 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{A} =$ Limit switch junction box
- $\mathbf{G} = 5$ -point calibration record
- $\mathbf{H} = \text{Pressure test, certificate}$
- T = Wall mounting
- **W** = Panel mounting
- **X** = Oil- and grease-free cleaning (**required** for oxygen service)
- Y = No needle valve
- **Z** = Top-mounted needle valve

# **Materials of Construction**

# M1 and M2 Models

Component	Material / Specification	
Flowmeter		
Head piece, foot piece, float, measuring tube, upper plug	316L stainless steel / EN 1.4404	
Upper float stop (spring)	316Ti stainless steel / EN 1.4571	
Plug gasket, lower float stop	PTFE	
Indicator housing	Painted aluminum	
Needle Valve		
Needle	316L stainless steel / EN 1.4404	
Gaskets	PTFE	
0-rings	Fluorocarbon (FKM) or Perfluorocarbon (FFKM)	
Housing, spring	316Ti stainless steel / EN 1.4571	
Spindle	316L stainless steel / EN 1.4404	
Spindle lubricant	PTFE-based	
Knob handle	Plastic	
Knob handle insert	Brass	
Knob handle set screw	A2 stainless steel	

Wetted components listed in italics.

# M3 and MH Models

Component	Material / Specification
Measuring tube, float, float stops, receiver, guide	316L stainless steel / EN 1.4404
Flange or NPT end connections	316L stainless steel / EN 1.4404
Indicator housing	Painted aluminum

Wetted components listed in italics.

#### M1 Model

The miniature M1 model is compact, yet offers protection against harsh environments and higher pressures with an armored measuring tube.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build an M1 model variable area flowmeter ordering number by combining the designators in the sequence shown below.



## 4 Measured Flow Range

Air, NL/min	Air, NL/h	Water, L/min	Water, L/h
<b>01L</b> = $0.08$ to $0.8$	01M = 5.0  to  50	A1L = 0.005  to  0.05	A1M = 0.3  to  3.0
02L = 0.17  to  1.7	02M = 10  to  100	A2L = 0.008  to  0.08	A2M = 0.5  to  5.0
03L = 0.25  to  2.5	03M = 15  to  150	A3L = 0.018  to  0.18	A3M = 1.0  to  10
<b>04L</b> = $0.67$ to $6.7$	04M = 40  to  400	A4L = 0.04  to  0.4	A4M = 2.5  to  25
<b>05L</b> = 1.3 to 13	05M = 80  to  800	<b>A5L</b> = $0.07$ to $0.7$	A5M = 4.0  to  40
06L = 2.0  to  20	06M = 125  to  1250	<b>A6L</b> = $0.1$ to $1.0$	A6M = 6.0  to  60
<b>07L</b> = 3.33 to 33.3	07M = 200  to  2000	<b>A7L</b> = $0.13$ to $1.3$	A7M = 8.0  to  80
<b>08L</b> = 4.2 to 42	08M = 250  to  2500	<b>A8L</b> = $0.17$ to $1.7$	<b>A8M</b> = $10 \text{ to } 100$
09L = 6.0  to  60	09M = 340  to  3400	Water, U.S. gal/min	Water, U.S. gal/h
Air, std ft³/min	Air, std ft³/h	A1R = 0.0013  to  0.013	A1S = 0.08  to  0.8
01R = 0.003  to  0.03	<b>01S</b> = $0.18$ to $1.8$	A2R = 0.0022  to  0.022	<b>A2S</b> = $0.13$ to $1.3$
02R = 0.006  to  0.06	02S = 0.37  to  3.7	A3R = 0.0045  to  0.045	<b>A3S</b> = $0.25$ to $2.5$
03R = 0.01  to  0.1	<b>03S</b> = 0.55 to 5.5	A4R = 0.01  to  0.1	A4S = 0.65  to  6.5
04R = 0.025  to  0.25	<b>04S</b> = 1.5 to 15	A5R = 0.018  to  0.18	A5S = 1.1  to  11
05R = 0.05  to  0.5	<b>05S</b> = 3.0 to 30	A6R = 0.025  to  0.25	<b>A6S</b> = $1.6 \text{ to } 16$
06R = 0.075  to  0.75	<b>06S</b> = 4.5 to 45	A7R = 0.035  to  0.35	A7S = 2.0  to  20
07R = 0.12  to  1.2	<b>07S</b> = 7.5 to 75	A8R = 0.045  to  0.45	<b>A8S</b> = $2.5 \text{ to } 25$
08R = 0.15  to  1.5	<b>08S</b> = 9.5 to 95		

# Custom

09R = 0.2 to 2.0

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid

09S = 13 to 130

# **Electrical Connections**

Up to two limit switches; junction box included

# Temperature Ranges With Limit Switches

 As ambient temperature increases, the process temperature maximum is reduced.

Process °F (°C)	Ambient °F (°C)
293 (145)	104 (40)
275 (135)	122 (50)
257 (125)	140 (60)

# **Dimensions**

See page 18 for M1 model dimensions.



# 5 Valve O-Ring Material

- 1 = Fluorocarbon (FKM) (standard)
- 2 = Perfluorocarbon (FFKM)

#### 6 Limit Switches with Junction Box (See page 20.)

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- $\mathbf{0} = None$
- 1 = Minimum switch
- **2** = Maximum switch
- 3 = Minimum and maximum switch
- 4 = Minimum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 5 = Maximum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 6 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 115 V (ac)
- 7 = Minimum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 8 = Maximum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 9 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 230 V (ac)

#### 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{B} = \mathsf{FM}$  Approval certificate
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- **X** = Oil- and grease-free cleaning (**required** for oxygen service)
- **Y** = No needle valve
- **Z** = Top-mounted needle valve



#### M2 Model

The M2 model offers versatility, with an integral junction box and choice of mechanical or electronic display.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

#### **Ordering Information**

Build an M2 model variable area flowmeter ordering number by combining the designators in the sequence shown below.

4 5 6 7 VAF - M2 - **01M - 1 - 1 - F** 

# 4 Measured Flow Range

mododiod i fott ital	.9*
Air, NL/min	Air, NL/h
<b>01L</b> = $0.08$ to $0.8$	01M = 5.0  to  50
<b>02L</b> = 0.17 to 1.7	02M = 10  to  100
<b>03L</b> = 0.25 to 2.5	03M = 15  to  150
<b>04L</b> = $0.67$ to $6.7$	04M = 40  to  400
<b>05L</b> = 1.3 to 13	05M = 80  to  800
<b>06L</b> = 2.0 to 20	06M = 125  to  1250
<b>07L</b> = 3.33 to 33.3	07M = 200  to  2000
<b>08L</b> = 4.2 to 42	08M = 250  to  2500
09L = 6.0  to  60	09M = 340  to  3400
Air, std ft³/min	Air, std ft³/h
<b>Air, std ft³/min 01R</b> = 0.003 to 0.03	<b>Air, std ft³/h 01S</b> = 0.18 to 1.8
•	,
01R = 0.003  to  0.03	<b>01S</b> = 0.18 to 1.8
<b>01R</b> = 0.003 to 0.03 <b>02R</b> = 0.006 to 0.06	<b>01S</b> = 0.18 to 1.8 <b>02S</b> = 0.37 to 3.7
<b>01R</b> = 0.003 to 0.03 <b>02R</b> = 0.006 to 0.06 <b>03R</b> = 0.01 to 0.1	<b>01S</b> = 0.18 to 1.8 <b>02S</b> = 0.37 to 3.7 <b>03S</b> = 0.55 to 5.5
01R = 0.003 to 0.03 02R = 0.006 to 0.06 03R = 0.01 to 0.1 04R = 0.025 to 0.25	<b>01S</b> = 0.18 to 1.8 <b>02S</b> = 0.37 to 3.7 <b>03S</b> = 0.55 to 5.5 <b>04S</b> = 1.5 to 15 <b>05S</b> = 3.0 to 30
01R = 0.003 to 0.03 02R = 0.006 to 0.06 03R = 0.01 to 0.1 04R = 0.025 to 0.25 05R = 0.05 to 0.5	<b>01S</b> = 0.18 to 1.8 <b>02S</b> = 0.37 to 3.7 <b>03S</b> = 0.55 to 5.5 <b>04S</b> = 1.5 to 15 <b>05S</b> = 3.0 to 30
01R = 0.003 to 0.03 02R = 0.006 to 0.06 03R = 0.01 to 0.1 04R = 0.025 to 0.25 05R = 0.05 to 0.5 06R = 0.075 to 0.75	01S = 0.18 to 1.8 02S = 0.37 to 3.7 03S = 0.55 to 5.5 04S = 1.5 to 15 05S = 3.0 to 30 06S = 4.5 to 45

Water, L/min	Water, L/h
A1L = 0.005  to  0.05	A1M = 0.3  to  3.0
A2L = 0.008  to  0.08	A2M = 0.5  to  5.0
A3L = 0.018  to  0.18	A3M = 1.0  to  10
A4L = 0.04  to  0.4	A4M = 2.5  to  25
<b>A5L</b> = $0.07$ to $0.7$	A5M = 4.0  to  40
<b>A6L</b> = $0.1 \text{ to } 1.0$	A6M = 6.0  to  60
A7L = 0.13  to  1.3	A7M = 8.0  to  80
<b>A8L</b> = $0.17$ to $1.7$	A8M = 10  to  100
Water, U.S. gal/min	Water, U.S. gal/h
<b>Water, U.S. gal/min A1R</b> = 0.0013 to 0.013	<b>Water, U.S. gal/h A1S</b> = 0.08 to 0.
, •	, •
A1R = 0.0013  to  0.013	A1S = 0.08  to  0.
<b>A1R</b> = 0.0013 to 0.013 <b>A2R</b> = 0.0022 to 0.022	<b>A1S</b> = $0.08$ to $0$ . <b>A2S</b> = $0.13$ to $1$ .
<b>A1R</b> = 0.0013 to 0.013 <b>A2R</b> = 0.0022 to 0.022 <b>A3R</b> = 0.0045 to 0.045	<b>A1S</b> = 0.08 to 0. <b>A2S</b> = 0.13 to 1. <b>A3S</b> = 0.25 to 2.
<b>A1R</b> = 0.0013 to 0.013 <b>A2R</b> = 0.0022 to 0.022 <b>A3R</b> = 0.0045 to 0.045 <b>A4R</b> = 0.01 to 0.1	<b>A1S</b> = 0.08 to 0. <b>A2S</b> = 0.13 to 1. <b>A3S</b> = 0.25 to 2. <b>A4S</b> = 0.65 to 6.
<b>A1R</b> = 0.0013 to 0.013 <b>A2R</b> = 0.0022 to 0.022 <b>A3R</b> = 0.0045 to 0.045 <b>A4R</b> = 0.01 to 0.1 <b>A5R</b> = 0.018 to 0.18	<b>A1S</b> = 0.08 to 0. <b>A2S</b> = 0.13 to 1. <b>A3S</b> = 0.25 to 2. <b>A4S</b> = 0.65 to 6. <b>A5S</b> = 1.1 to 11
A1R = 0.0013 to 0.013 A2R = 0.0022 to 0.022 A3R = 0.0045 to 0.045 A4R = 0.01 to 0.1 A5R = 0.018 to 0.18 A6R = 0.025 to 0.25	<b>A1S</b> = 0.08 to 0. <b>A2S</b> = 0.13 to 1. <b>A3S</b> = 0.25 to 2. <b>A4S</b> = 0.65 to 6. <b>A5S</b> = 1.1 to 11 <b>A6S</b> = 1.6 to 16

#### Custom

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid

#### **Electrical Connections**

- Up to two limit switches
- 2-wire, 4 to 20 mA output signal with LED display available

#### **Temperature Ranges**

 As ambient temperature increases, the process temperature maximum is reduced.

#### With Limit Switches

Process °F (°C)	Ambient °F (°C)
302 (150)	104 (40)
257 (125)	122 (50)
212 (100)	140 (60)

#### With 4 to 20 mA Output Signal

Process °F (°C)	Ambient °F (°C)
275 (135)	104 (40)
230 (110)	122 (50)
182 (85)	140 (60)

#### **Dimensions**

See page 18 for M2 model dimensions.



Standard M2 Model



M2 Model with LED Display

# 5 Valve O-Ring Material

- **1** = Fluorocarbon (FKM) (standard)
- 2 = Perfluorocarbon (FFKM)

# 6 Limit Switches or Electronic Display (See page 20.)

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

 $\mathbf{0} = None$ 

8

3

5

5

- 1 = Minimum switch
- 2 = Maximum switch
- **3** = Minimum and maximum switch
- 4 = Minimum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 5 = Maximum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 6 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 115 V (ac)
- 7 = Minimum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 8 = Maximum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 9 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 230 V (ac)
- **E** = LED display of measured flow with 4 to 20 mA output signal

# 7 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- **F** = Certificate of compliance
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- X = 0il- and grease-free cleaning (required for oxygen service)
- Y = No needle valve
- **Z** = Top-mounted needle valve



#### M3 Model

This metal-tube flowmeter, with rugged design, is suited for extreme operating conditions and high flow rates.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build an M3 model variable area flowmeter ordering number by combining the designators in the sequence shown below. Choose end connections and measured flow range designators based on measuring tube size.

VAF - M3 - 1 - 1 - 01M - 1 A - F

# 4 Measuring Tube Size

1 = 1/2 in.

**2** = 1 in.

# 5 End Connections

#### 1/2 in. Measuring Tube

1 = 1/2 in. NPT

**2** = 3/4 in. NPT

3 = 1/2 in. ASME class 150 flange

4 = 3/4 in. ASME class 150 flange

**5** = 1 in. ASME class 150 flange

#### 1 in. Measuring Tube

1 = 3/4 in. NPT

2 = 1 in. NPT

3 = 3/4 in. ASME class 150 flange

4 = 1 in. ASME class 150 flange

# 6 Measured Flow Range

1/2 in. Measuring Tube

.,	
Air, NL/min	Air, NL/h
<b>01L</b> = 1.1 to 11	01M = 70  to  700
<b>02L</b> = 1.7 to 17	02M = 100  to  1000
03L = 2.5  to  25	03M = 150  to  1500
04L = 4.0  to  40	04M = 220  to  2200
05L = 6.0  to  60	
<b>06L</b> = 10 to 100	06M = 550  to  5500
<b>07L</b> = 17 to 170	07M = 1000  to  10 000
<b>08L</b> = 25 to 250	08M = 1400  to  14000
<b>09L</b> = $30 \text{ to } 300$	09M = 1800  to  18000
<b>10L</b> = $50 \text{ to } 500$	$10M = 2800 \text{ to } 28\ 000$
Air, std ft³/min	Air, std ft³/h
01R = 0.04  to  0.4	<b>01S</b> = 2.5 to 25
02R = 0.06  to  0.6	02S = 4.0  to  40
03R = 0.01  to  0.1	<b>03S</b> = 5.5 to 55
04R = 0.14  to  1.4	04S = 8.0  to  80
05R = 0.2  to  2.0	<b>05S</b> = 13 to 130
06R = 0.35  to  3.5	<b>06S</b> = 20 to 200
07R = 0.6  to  6.0	<b>07S</b> = 38 to 380
08R = 0.8  to  8.0	<b>08S</b> = 52 to 520
09R = 1.0  to  10	<b>09S</b> = 65 to 650
<b>10R</b> = 1.6 to 16	<b>10S</b> = 100 to 1000

1/2 in. Measuring Tube	
Water, L/min	Water, L/h
<b>A1L</b> = $0.03$ to $0.3$	A1M = 1.8  to  18
A2L = 0.04  to  0.4	A2M = 2.5  to  25
A3L = 0.05  to  0.5	A3M = 3.0  to  30
<b>A4L</b> = $0.07$ to $0.7$	A4M = 4.0  to  40
<b>A5L</b> = $0.095$ to $0.95$	A5M = 5.5  to  55
<b>A6L</b> = $0.105$ to $1.05$	A6M = 6.3  to  63
<b>A7L</b> = $0.13$ to $1.3$	A7M = 8.0  to  80
<b>A8L</b> = $0.17$ to $1.7$	A8M = 10  to  100
<b>A9L</b> = $0.2$ to $2.0$	A9M = 12  to  120
<b>B1L</b> = $0.27$ to $2.7$	B1M = 16  to  160
<b>B2L</b> = $0.35$ to $3.5$	B2M = 20  to  200
B3L = 0.4  to  4.0	B3M = 25  to  250
<b>B4L</b> = $0.6$ to $6.0$	<b>B4M</b> = $35 \text{ to } 350$
<b>B5L</b> = $0.7$ to $7.0$	<b>B5M</b> = $40 \text{ to } 400$
<b>B6L</b> = $0.85$ to $8.5$	B6M = 50  to  500
<b>B7L</b> = $1.05$ to $10.5$	B7M = 63  to  630
<b>B8L</b> = $1.2 \text{ to } 12$	<b>B8M</b> = $70 \text{ to } 700$
<b>B9L</b> = 1.7 to 17	<b>B9M</b> = $100 \text{ to } 1000$
	<b>DOM</b> = 100 to 1000
Water, U.S. gal/min	Water, U.S. gal/h
<b>Water, U.S. gal/min A1R</b> = 0.008 to 0.08	<b>Water, U.S. gal/h A1S</b> = 0.48 to 4.8
<b>Water, U.S. gal/min A1R</b> = 0.008 to 0.08 <b>A2R</b> = 0.01 to 0.1	<b>Water, U.S. gal/h A1S</b> = 0.48 to 4.8 <b>A2S</b> = 0.65 to 6.5
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15	<b>Water, U.S. gal/h A1S</b> = 0.48 to 4.8 <b>A2S</b> = 0.65 to 6.5 <b>A3S</b> = 0.8 to 8.0
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1 B4R = 0.15 to 1.5	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65 B4S = 9.0 to 90
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1 B4R = 0.15 to 1.5 B5R = 0.18 to 1.8	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65 B4S = 9.0 to 90 B5S = 10 to 100
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1 B4R = 0.15 to 1.5 B5R = 0.18 to 1.8 B6R = 0.22 to 2.2	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65 B4S = 9.0 to 90 B5S = 10 to 100 B6S = 13 to 130
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1 B4R = 0.15 to 1.5 B5R = 0.18 to 1.8 B6R = 0.22 to 2.2 B7R = 0.28 to 2.8	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65 B4S = 9.0 to 90 B5S = 10 to 100 B6S = 13 to 130 B7S = 16 to 160
Water, U.S. gal/min A1R = 0.008 to 0.08 A2R = 0.01 to 0.1 A3R = 0.015 to 0.15 A4R = 0.018 to 0.18 A5R = 0.025 to 0.25 A6R = 0.03 to 0.3 A7R = 0.035 to 0.35 A8R = 0.045 to 0.45 A9R = 0.05 to 0.5 B1R = 0.07 to 0.7 B2R = 0.09 to 0.9 B3R = 0.11 to 1.1 B4R = 0.15 to 1.5 B5R = 0.18 to 1.8 B6R = 0.22 to 2.2	Water, U.S. gal/h A1S = 0.48 to 4.8 A2S = 0.65 to 6.5 A3S = 0.8 to 8.0 A4S = 1.1 to 11 A5S = 1.5 to 15 A6S = 1.6 to 16 A7S = 2.0 to 20 A8S = 2.5 to 25 A9S = 3.0 to 30 B1S = 4.2 to 42 B2S = 5.0 to 50 B3S = 6.5 to 65 B4S = 9.0 to 90 B5S = 10 to 100 B6S = 13 to 130

#### **Custom**

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid



#### M3 Model

#### **Electrical Connections**

- Up to two limit switches (M16 × 1.5 cable glands standard)
- 2-wire 4 to 20 mA output signal available

# Temperature Ranges With Limit Switches or 4 to 20 mA Output Signal

- Ambient low temperature is limited to -13°F (-25°C) with limit switches.
- As ambient temperature increases, the process temperature maximum is reduced.

Process °F (°C)	Ambient °F (°C)
392 (200)	104 (40)
356 (180)	140 (60)

# 6 Measured Flow Range

#### 1 in. Measuring Tube

1 in. Measuring Tube	
Air, NL/min	Air, NL/h
<b>01L</b> = 25 to 250	01M = 1400  to  14000
02L = 40  to  400	$02M = 2300 \text{ to } 23\ 000$
03L = 60  to  600	03M = 3500  to  35000
<b>04L</b> = 100 to 1000	04M = 5000  to  50 000
<b>05L</b> = 200 to 2000	<b>05M</b> = 11 000 to 110 000
<b>06L</b> = 300 to 3000	<b>06M</b> = 18 000 to 180 000
Air, std ft³/min	Air, std ft³/h
01R = 1.0  to  10	<b>01S</b> = 52 to 520
02R = 1.5  to  15	<b>02S</b> = 85 to 850
03R = 2.0  to  20	<b>03S</b> = 130 to 1300
04R = 3.0  to  30	<b>04S</b> = 190 to 1900
05R = 6.5  to  65	<b>05S</b> = 400 to 4000
06R = 10  to  100	<b>06S</b> = 670 to 6700
Water, L/min	Water, L/h
<b>A1L</b> = $0.8 \text{ to } 8.0$	A1M = 48  to  480
A2L = 1.05  to  10.5	A2M = 63  to  630
A3L = 1.5  to  15	A3M = 82  to  820
A4L = 1.7  to  17	A4M = 100  to  1000
<b>A5L</b> = $2.0 \text{ to } 20$	A5M = 120  to  1200
<b>A6L</b> = $2.7$ to $27$	A6M = 160  to  1600
A7L = 3.0  to  30	A7M = 170  to  1700
<b>A8L</b> = $4.2 \text{ to } 42$	<b>A8M</b> = $250 \text{ to } 2500$
A9L = 5.5  to  55	A9M = 320  to  3200
<b>B1L</b> = $7.0 \text{ to } 70$	B1M = 400  to  4000
<b>B2L</b> = $10 \text{ to } 100$	<b>B2M</b> = $630 \text{ to } 6300$
Water, U.S. gal/min	Water, U.S. gal/h
A1R = 0.2  to  2.0	<b>A1S</b> = $13 \text{ to } 130$
A2R = 0.28  to  2.8	<b>A2S</b> = 16 to 160
A3R = 0.35  to  3.5	<b>A3S</b> = 22 to 220
A4R = 0.45  to  4.5	<b>A4S</b> = 25 to 250
A5R = 0.5  to  5.0	<b>A5S</b> = 32 to 320
A6R = 0.7  to  7.0	<b>A6S</b> = 42 to 420
A7R = 0.75  to  7.5	<b>A7S</b> = 45 to 450
<b>A8R</b> = 1.0 to 10	<b>A8S</b> = 65 to 650
<b>A9R</b> = 1.5 to 15	<b>A9S</b> = 85 to 850
<b>B1R</b> = 1.8 to 18	<b>B1S</b> = 110 to 1100
B2R = 3.0  to  30	<b>B2S</b> = $160 \text{ to } 1600$

#### Custom

See Custom Calibration, page 20.

GAS = Gas LIQ = Liquid

# 7 Limit Switches (See page 20.)

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

- $\mathbf{0} = None$
- 1 = Minimum switch
- 2 = Maximum switch
- 3 = Minimum and maximum switch
- 4 = Minimum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 5 = Maximum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)
- 6 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 115 V (ac)
- 7 = Minimum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 8 = Maximum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)
- 9 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 230 V (ac)

# 8 Output Signal

Omit designator if output signal not ordered.

 $\mathbf{A} = 4 \text{ to } 20 \text{ mA}$ 

# 9 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- **B** = FM Approval certificate
- $\mathbf{F} = \text{Certificate of compliance}$
- **G** = 5-point calibration record
- **H** = Pressure test, certificate
- **J** = Material certification
- **L** = Dye penetration test, certificate
- N = X-ray test, report
- **P** = Hardness test, report
- $\mathbf{R} = 1/2$  in. female NPT conduit gland
- $\mathbf{S} = M20 \times 1.5$  cable gland
- **X** = 0il- and grease-free cleaning (**required** for oxygen service)

# **Dimensions**

See page 19 for M3 model dimensions.





#### **MH Model**

This horizontal model offers liquid flow reading left-to-right or right-to-left to meet system requirements.

#### **Technical Data**

See Variable Area Flowmeter Selection, page 2.

# **Ordering Information**

Build an MH model variable area flowmeter ordering number by combining the designators in the sequence shown below. Choose end connections and measured flow range designators based on measuring tube size.

VAF - MH - 1 - 1 - A1M - 1 A - RL - F

# 4 Measuring Tube Size

1 = 1/2 in.

2 = 1 in.

# 5 End Connections

#### 1/2 in. Measuring Tube

1 = 3/4 in. NPT

2 = 1/2 in. ASME class 150 flange

3 = 3/4 in. ASME class 150 flange

**4** = 1 in. ASME class 150 flange

#### 1 in. Measuring Tube

**1** = 1 1/4 in. NPT

2 = 1 in. ASME class 150 flange

# 6 Measured Flow Range

# 1/2 in. Measuring Tube Water, L/min Water, L/h

A1M = 7.0 to 70A1L = 0.11 to 1.1A2M = 12 to 120A2L = 0.2 to 2.0A3L = 0.3 to 3.0A3M = 18 to 180A4L = 0.5 to 5.0A4M = 28 to 280**A5L** = 0.75 to 7.5A5M = 45 to 450A6M = 70 to 700A6L = 1.2 to 12A7L = 2.0 to 20A7M = 120 to 1200A8L = 2.5 to 25A8M = 160 to 1600

 A9L = 4.0 to 40
 A9M = 240 to 2400

 Water, U.S. gal/min
 Water, U.S. gal/h

 A1R = 0.03 to 0.3
 A1S = 2.0 to 20

 A2R = 0.05 to 0.5
 A2S = 3.0 to 30

 A3R = 0.08 to 0.8
 A3S = 5.0 to 50

 A4R = 0.12 to 1.2
 A4S = 8.0 to 80

 A5S = 12 to 120

**A6R** = 0.3 to 3.0 **A6S** = 20 to 200 **A7R** = 0.5 to 5.0 **A7S** = 32 to 320 **A8R** = 0.7 to 7.0 **A8S** = 43 to 430

**A9R** = 1.07 to 10.7 **A9S** = 64 to 640

# 1 in. Measuring Tube

 Water, L/min
 Water, L/h

 A1L = 2.0 to 20
 A1M = 130 to 1300

 A2L = 3.0 to 30
 A2M = 200 to 2000

 A3L = 5.0 to 50
 A3M = 300 to 3000

 A4L = 8.0 to 80
 A4M = 500 to 5000

 A5L = 15 to 150
 A5M = 850 to 8500

 A6L = 17 to 170
 A6M = 1000 to 10 000

 Water, U.S. gal/min
 Water, U.S. gal/h

 A1R = 0.6 to 6.0
 A1S = 35 to 350

 A2R = 0.9 to 9.0
 A2S = 55 to 550

 A3R = 1.4 to 14
 A3S = 80 to 800

 A4R = 2.2 to 22
 A4S = 130 to 1300

**A5S** = 230 to 2300

A6S = 270 to 2700

**A5R** = 4.0 to 40 **A6R** = 4.5 to 45

#### Custom

See Custom Calibration, page 20.

**LIQ** = Liquid

# Limit Switches (See page 20.)

Limit switch amplifiers are required. Amplifiers can be ordered with the flowmeter or customer supplied.

 $\mathbf{0} = None$ 

1 = Minimum switch

2 = Maximum switch

3 = Minimum and maximum switch

4 = Minimum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)

5 = Maximum switch and a one-channel isolated switch amplifier with relay output, 115 V (ac)

6 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 115 V (ac)

7 = Minimum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)

8 = Maximum switch and a one-channel isolated switch amplifier with relay output, 230 V (ac)

9 = Minimum and maximum switch and a two-channel isolated switch amplifier with relay output, 230 V (ac)



#### MH Model

#### **Electrical Connections**

- Up to two limit switches (M16 × 1.5 cable glands standard)
- 2-wire 4 to 20 mA output signal available

# Temperature Ranges With Limit Switches or 4 to 20 mA Ouput Signal

- Ambient low temperature is limited to –13°F (–25°C) with limit switches.
- As ambient temperature increases, the process temperature maximum is reduced.

Process °F (°C)	Ambient °F (°C)
392 (200)	104 (40)
356 (180)	140 (60)

# 8 Output Signal

Omit designator if output signal not ordered.

 $\mathbf{A} = 4 \text{ to } 20 \text{ mA}$ 

## 9 Flow Direction

**RL** = Right-to-left

LR = Left-to-right

# 10 Options (See page 20.)

Add multiple designators in alphabetical order; omit final dash (-) if no options are ordered.

- $\mathbf{F} = \text{Certificate of compliance}$
- $\mathbf{G} = 5$ -point calibration record
- $\mathbf{H} = \text{Pressure test, certificate}$
- **J** = Material certification
- L = Dye penetration test, certificate
- **N** = X-ray test, report
- $\mathbf{P} = \text{Hardness test, report}$
- $\mathbf{R} = 1/2$  in. female NPT conduit gland
- $\mathbf{S} = M20 \times 1.5$  cable gland
- **X** = 0il- and grease-free cleaning (**required** for oxygen service)




Left-to-Right Flow Model


# **Dimensions**


Dimensions, in inches and (millimeters), are for reference only and are subject to change.

# G1, G2, G3, G4, and GP Models

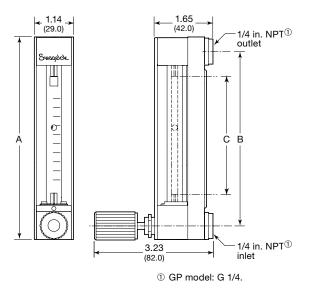

# M1 Model

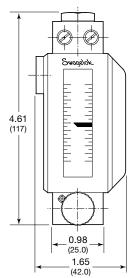


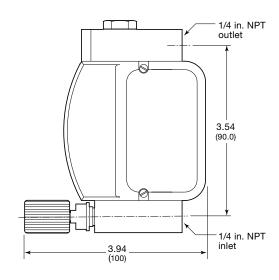

Weight: 1.53 lb (0.7 kg)


	Din	Weight		
Model	A	В	C	lb (kg)
G1	4.37 (111)	3.54 (90.0)	1.77 (45.0)	0.80 (0.36)
G2	5.75 (146)	4.92 (125)	3.15 (80.0)	0.89 (0.40)
G3	7.72 (196)	6.89 (175)	5.12 (130)	0.98 (0.44)
G4	13.6 (346)	12.8 (325)	11.0 (280)	1.35 (0.61)
GP	5.75 (146)	4.92 (125)	3.15 (80.0)	0.44 (0.20)


# **GM Model**

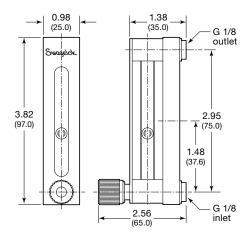

Weight: 0.18 lb (0.08 kg)

## M2 Model

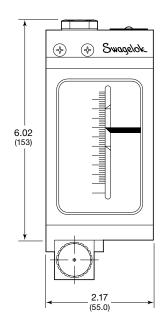

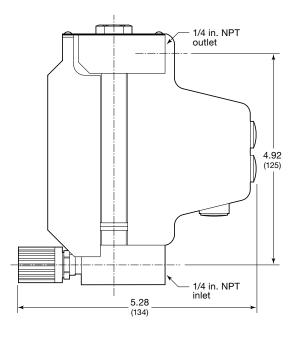


Weight: 2.2 lb (1.0 kg)


# **Dimensions**

Dimensions, in inches and (millimeters), are for reference only and are subject to change.


# M3 Model

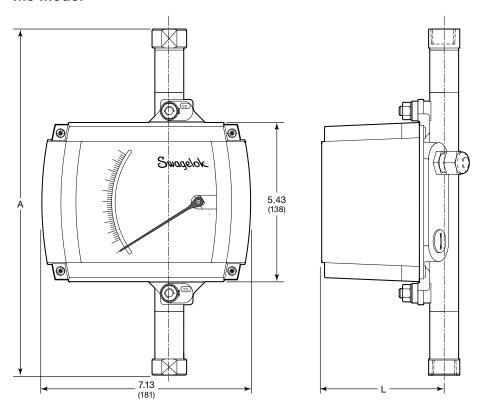

# **MH Model**

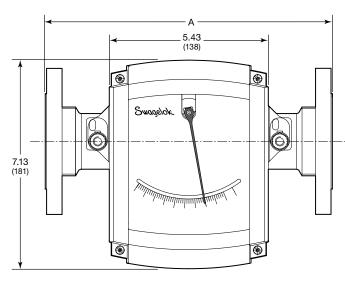

Right-to-Left Flow Model

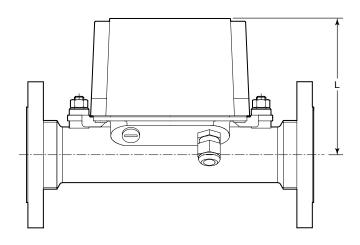

# M3 Model and MH Model

Tube Size	Process End	Dimension	Weight		
in.	Connection	A	L	lb (kg)	
1/2	NPT	11.8 (300)	4.21 (107)	4.4 (2.0)	
	Flange	9.84 (250)	4.21 (107)	7.1 (3.2)	
4	NPT	11.8 (300)	4.69 (119)	7.7 (3.5)	
1	Flange	9.84 (250)	4.69 (119)	11.5 (5.2)	



## **Custom Calibration**

Standard Swagelok variable area flowmeters are factory calibrated to their media, flow range, and accuracy class using clean, dry air for air-flow range models and water for water-flow range models. Standard units of measure marked on the scale are calibrated to:

- 17.4 psia (1.2 bar) and 68°F (20°C) for G1, G2, G3, GM, and GP models.
- 14.7 psia (1.013 bar) and and 68°F (20°C) for G4, M1, M2, M3, and MH models.

Custom-calibrated flowmeters are available for fluids with properties substantially different from those of air or water, as well as systems operating at higher pressures or temperatures.

Flowmeters calibrated for one fluid at a specific pressure and temperature can be used to measure other fluids and different pressures and temperatures by using a conversion factor. See the Swagelok *Variable Area Flowmeters Installation Instructions, G Series and M Series,* MS-CRD-0111, for more information.

In liquids, higher temperature can reduce viscosity and density, resulting in lower readings. In gases, higher fluid temperature can increase volume and result in higher readings. Knowing the specific fluid temperature enables us to calibrate the scale more accurately.

Increased pressure can compress gases and lead to lower meter readings. Knowing the system pressure enables us to calibrate the scale properly for your application.

To order a custom Swagelok variable area flowmeter calibrated to meet your requirements as shown below, use **GAS** or **LIQ** as the flow range designator in the desired model ordering number and contact your authorized Swagelok representative. You will need to specify:

- 1. Fluid to be measured
- Fluid dynamic viscosity, typically in cP or mPa·s, or kinetic viscosity, typically in cSt or m²/s, at operating pressure and temperature
- Fluid density in lb/ft<sup>3</sup> or kg/m<sup>3</sup> at operating pressure and temperature
- Fluid temperature at operating conditions, with unit of measure
- 5. Fluid pressure at operating conditions, with unit of measure
- 6. Flow measurement range and unit of measure.

Swagelok custom-calibrated variable area flowmeters must maintain a 10-to-1 turndown ratio and are matched as closely as possible to the desired flow measurement range. Custom-calibrated flowmeters are marked with the fluid media and unit of measure for which they are calibrated.

# **Options**

Options are specified in variable area flowmeter ordering numbers as shown in **Ordering Information** for each model.

#### **Electrical Options**

Two electrical options are available with select Swagelok variable area flowmeter models:

- discrete limit switch outputs for indicating high/low flow
- 4 to 20 mA output signal.

#### **Limit Switches**


Optional minimum or maximum limit switches available for most models are compliant with NAMUR IEC 60947-5-6 (EN 60947-5-6).

#### **Output Signal**

Some variable area flowmeter models are available with a separate two-wire 4 to 20 mA output signal. These models

require auxiliary power of 14.8 to 30 V (dc).

For more information about electrical options, see the Swagelok *Variable Area Flowmeters Installation Instructions, G Series and M Series,* MS-CRD-0111, available *only* on your Swagelok website.

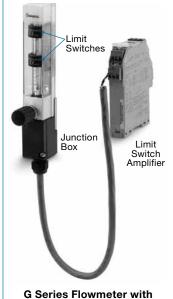

#### G Series Flowmeter with Limit Switches, Junction Box, and Isolated Switch Amplifier with Relay Output

#### **Junction Boxes**

Junction boxes, available on select Swagelok variable area flowmeter models, can be mounted to the flowmeter to facilitate electrical connections between the flowmeter and the control system. Junction boxes are suggested when limit switches are ordered.

# Threaded Conduit Gland and M20 $\times$ 1.5 Cable Gland (M3 and MH Models)

The standard cable gland assembled onto the flowmeter casing to guide the wiring for electronic options is M16  $\times$  1.5 thread. Available options are a 1/2 in. female NPT end connection and an M20  $\times$  1.5 end connection.

# **Valve Position**

An integral needle valve for fine metering is provided on some products, on the bottom (inlet) side of the flowmeter. Upon request, the valve can be mounted on the top (outlet) side or omitted from the assembly.

For gas applications, the valve is typically on the top (behind the measuring cone) to help maintain constant pressure in the measuring cone despite changes in density caused by gas compression or decompression. For liquids, the valve can be on the bottom or the top, because pressure changes do not affect liquid density.



# **Options**

Options are specified in variable area flowmeter ordering numbers as shown in **Ordering Information** for each model.

# **Certificates and Test Reports**

#### FM Approvals Certificate

Swagelok M1 and M3 models are available with FM Approvals certificates of compliance.

#### M1 Model

- Intrinsically safe for Class I, II, and III, Division 1, Groups A, B, C, D, E, F, and G
- Nonincendive for Class I, Division 2, Groups A, B, C, and D
- Suitable for Class II and III, Division 2, Groups F and G
- Associated apparatus nonincendive for Class I, II, and III, Division 2, Groups A, B, C, D, F, and G
- Temperature class T5 at ambient 140°F (60°C)
- Type 4X

#### M3 Model

- Intrinsically safe for Class I, Division 1, Groups A, B, C, and D
- Associated apparatus nonincendive for Class I, Division 2, Groups A, B, C, and D
- Nonincendive for Class I, Division 2, Groups A, B, C, and D
- Type 4X

#### Certificate of Compliance

This document certifies that the products supplied to the customer by the manufacturer are in compliance with the requirements of the order, in accordance with EN 10204.

#### 5-Point Calibration Record

The calibration record shows actual flow performance, theoretical performance, and error over the measurement range.

#### Pressure Test and Certificate

A hydrostatic pressure test based on EN 10204 is available.

#### **Material Certification**

This inspection certificate, in accordance with EN 10204, shows the material and heat numbers of the pressure-bearing and wetted materials, as well as the original mill material certifications of the wetted materials.

#### Dye Penetration Test and Certificate

A dye penetration test is available for wetted welds. For acceptance criteria, the related material standard is used.

#### X-Ray Test and Report

An X-ray test is available for wetted welds. The test procedure follows EN 1435-1 Class B. Acceptance criteria are in accordance with ISO 5817 group.

#### Hardness Test and Report

A hardness test on wetted metal components, based on ASTM A956, is available.

#### Oil- and Grease-Free Cleaning

An additional degreasing operation is available that meets the requirements of DIN 25410 and KWU-AVS 8/0 D. This option must be selected on flowmeters calibrated for oxygen service.

#### Oxygen Service Hazards

For information about hazards and risks of oxygen-enriched systems, see the Swagelok *Oxygen System Safety* technical report, MS-06-13.



# **Options**

Options are specified in variable area flowmeter ordering numbers as shown in Ordering Information for each model.


# **Mounting Brackets**

# **Panel Mounting**

Panel mounting is available for G1, G2, G3, G4, GM, and GP model flowmeters. The face plate is aluminum, and the rear brackets are steel.


G1, G2, G3, G4, and GP models are mounted with four nickelplated steel fasteners, included; GM models are mounted with an anodized aluminum clamp clip and 4 mm stainless steel Allen screw. Dimensions, in inches (millimeters) are for reference only and are subect to change.

	Dimensions, in. (mm)					
Model	Α	В	C	D	E	F
G1	5.04 (128)	1.26 (32.0)	5.71 (145)	1.58 (40.0)	1.75 (44.5)	3.23 (82.0)
G2, GP	6.42 (163)	1.26 (32.0)	7.09 (180)	1.58 (40.0)	1.75 (44.5)	3.23 (82.0)
G3	8.39 (213)	1.26 (32.0)	9.06 (230)	1.58 (40.0)	1.75 (44.5)	3.23 (82.0)
G4	14.3 (363)	1.26 (32.0)	15.0 (380)	1.58 (40.0)	1.75 (44.5)	3.23 (82.0)
GM	3.70 (94.0)	0.91 (23.0)	3.82 (97.0)	0.98 (25.0)	1.38 (35.0)	2.56 (65.0)

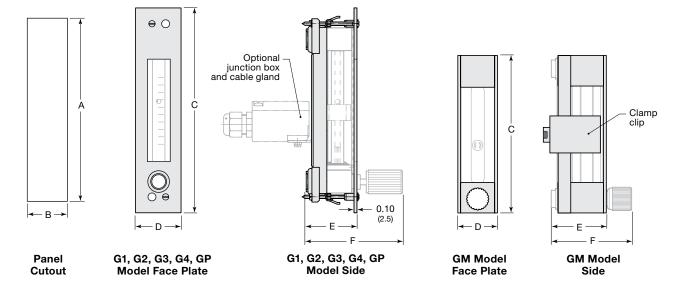

#### Wall Mounting

Black anodized aluminum wall mounting brackets are available for G1, G2, G3, and GP model flowmeters.

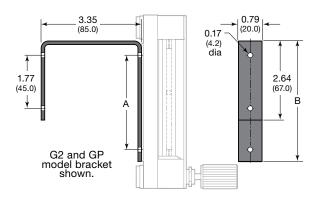

Dimensions, in inches (millimeters) are for reference only and are subect to change.

	Dimensions, in. (mm)		
Model	A	В	
G1	1.77 (45.0)	2.64 (97.0)	
G2, GP	3.15 (80.0)	4.02 (102)	
G3	5.12 (130)	5.98 (152)	



#### **Accessories**

# **Damping Device**

For unstable flows or low operating (inlet) pressures, particularly with gas applications, the measuring section can be fitted with a float damping device on some M3 and MH models. This device is self-locating, with working parts of high-tech ceramic to ensure a long service life.

For more information, contact your authorized Swagelok representative.

#### **Additional Products**

## **Pressure Regulators**

Swagelok offers a variety of pressure regulators.

- Spring-, dome-, and airloaded models
- Pressure-reducing regulators
- Back-pressure regulators
- Gas cylinder changeover manifolds
- Electrically heated and steam-heated vaporizing regulators.

For more information, see the Swagelok *Pressure Regulators* catalog, MS-02-230, and the Swagelok *Pressure Regulators, RHPS Series* catalog, MS-02-430.





# **Metering Valves**

Swagelok metering valves offer:

- Low- and high-pressure service
- Repeatable vernier handles
- Brass and 316 stainless steel materials.

For more information, see the Swagelok *Metering Valves* catalog, MS-01-142.





#### Safe Product Selection

When selecting a product, the total system design must be considered to ensure safe, trouble-free performance. Function, material compatibility, adequate ratings, proper installation, operation, and maintenance are the responsibilities of the system designer and user.

Caution: Do not mix or interchange parts with those of other manufacturers.

# **Warranty Information**

Swagelok products are backed by The Swagelok Limited Lifetime Warranty. For a copy, visit swagelok.com or contact your authorized Swagelok representative.